

Typical Applications

Proven use in vibration monitoring for offline applications using commercially available data collectors and online monitoring systems in the fields of Building Services, Civil Engineering, Paper and Pulp, Mining, Metals Manufacture, Utilities, Automotive, Water and Waste Treatment, Pharmaceutical, Aerospace, etc.

Protecting...

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyers, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, HVAC, Spindles, Machine Tooling, Process Equipment and many more.

Technical Performance

Mounted Base Resonance Sensitivity Frequency Response

Isolation Measurement Range Transverse Sensitivity

Electrical

Electrical Noise Current Range Bias Voltage Settling Time Output Impedance Case Isolation

Environmental

Operating Temperature Range Sealing Maximum Shock Emissions Immunity

Mechanical

Case Material Sensing Element/Construction Mounting Torque Weight Maximum Cable length Mating Connector Mounting Threads Options 22 kHz (nominal) 100 mV/g +/-10 % Nominal 80 Hz at 22°C 2 Hz to 10 kHz +/-5 % 0,8 Hz to 15 kHz +/-3 dB Base isolated +/-80 g Less than 5 %

0,1 mg max 0,5 mA to 8 mA 10 - 12 Volts DC 2 seconds 200 Ohms max. >10⁸ Ohms at 500 Volts


-55 to 140 °C IP67 5000 g EN61000-6-4:2001 EN61000-6-2:1999


Stainless Steel PZT/Compression 8 Nm 110 gms (nom) 1000 meters HS -AA004 See 'How to order' table Integral cable, filters, temperature output, various connector assemblies, other sensitivities




Tel : 0032 (0) 65/45.72.14 Fax : 0032 (0) 65/36.17.46 Email: info@icareweb.com Web: www.icareweb.com

IC-100 Series Vibration Sensor

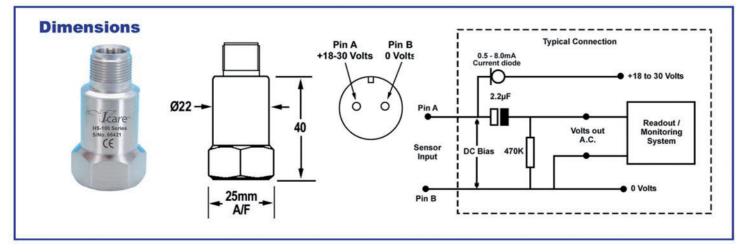

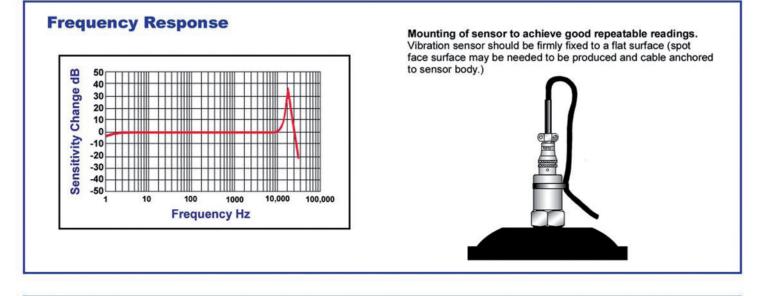

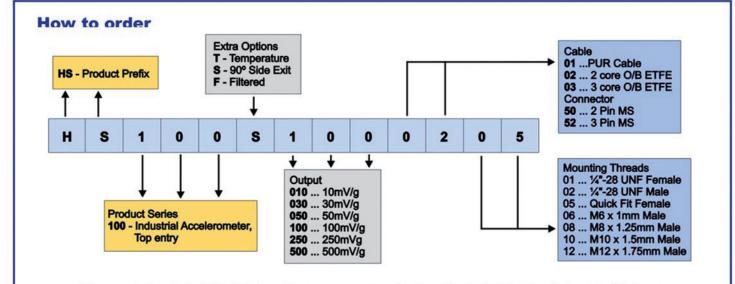

Please contact our Sales Office for information on sensor accessories (mounting studs, etc) and multichannel switch boxes.

TS001 Iss01

2,,,

We reserve the right to alter the specification of this product without prior notice.

17₽™

Tél : 0032 (0) 65/45.72.14 Fax : 0032 (0) 65/36.17.46 Email: info@icareweb.com Web: www.icareweb.com



Ref: HS1002P-0107